

30-NOV-01

BOMBS ACTIVE (HANDLING DAMAGE)
AIRBORNE WEAPONS CORRECTIVE ACTION PROGRAM

TABLE OF CONTENTS

PROBLEM NUMBER	DESCRIPTION	PAGE NUMBER
<u>INDEXES</u>		
	EQUIPMENT INDEX	ii
	ACTION INDEX	iii
	ORIGINATORS INDEX	iv
	DUE DATE SUMMARY	v
 <u>PROBLEMS</u>		
<u>14655</u>	MK 122 SAFETY SWITCH LANYARD PULLED OUT DURING DOWNLOADING.....	1
<u>15620</u>	MK-20 CBU SHIPPING CONTAINER PUNCTURED.....	3
<u>16988</u>	BSU-86/B FIN DAMAGED DURING HANDLING.....	5

NOTE: OPEN problems denoted by asterisk (*) following problem number.

30-NOV-01

**BOMBS ACTIVE (HANDLING DAMAGE)
AIRBORNE WEAPONS CORRECTIVE ACTION PROGRAM**

PROBLEM NO: 14655

CLOSED

	NOMENCLATURE	PART/DOC. NO.	FSC	NIIN	NALC
END ITEM :	BOMB, GENERAL PURPOSE	1380523	1325	00-710-6765	F127
	SWITCH, ARMING, SAFETY	2288036	1325	00-883-9021	GW03

EI CNTRL NO:

PROB BRIEF : MK 122 SAFETY SWITCH LANYARD PULLED OUT DURING DOWNLOADING

PROBLEM : Lanyard from Mk 122 safety switch pulled during downloading.
DESCRIPTION

PREVENTIVE : Strict adherence to checklist.
ACTION

CORRECTIVE : Disposed of.
ACTION

	SOURCE	TYPE	DOCUMENT NO.	DATE	DR STATUS
OCCURRENCES:	VF-41	CODR	V09774-01-0012	06SEP01	CLOSED
	VA-36	EMR	V09941-91-0010	05APR91	CLOSED *

*** ACTION REPORTED IN PREVIOUS PUBLICATION**

ACTION : VF-41 CODR V09774-01-0012 06SEP01 CLOSED

	PART/DOC. NO.	FSC	NIIN	NALC
END ITEM :	2288036	1325	00-883-9021	GW03
	NOMEN: SWITCH, ARMING, SAFETY			
	S/N: UNKNOWN			
FAILED PART:	2288036	1325	00-883-9021	GW03
	NOMEN: SWITCH, ARMING, SAFETY			
	S/N: UNKNOWN			

DESCRIPTION:

It was reported that during loading of a GBU-12, the aft lug did not lock properly in the aft hook of the weapons rail. Team leader unlocked rack and instructed crew to raise weapons rail. Arming safety switch MK-122, Mod 0, NALC GW03 lanyard had been hooked to the positive arming latch. Lanyard was not removed from positive arming latch prior to upward movement of the weapons rail causing lanyard to be pulled from the safety switch. Training conducted as refresher.

ACTION TAKEN:

NAWC Pt. Mugu 070729ZSEP01: Concur with above training conducted. Dispose of MK-122 Mod 0 safety switch in accordance with local instruction/directives. Return GBU-12 to ready for issue Condition Code "A". No further action planned. Problem will be monitored for future occurrences. This is closing action.

30-NOV-01

BOMBS ACTIVE (HANDLING DAMAGE)
AIRBORNE WEAPONS CORRECTIVE ACTION PROGRAM

PROBLEM NO: 14655

(Continued)

ACTION	:	ACTIVITY/CODE	ASSIGNMENT	DUE DATE	STATUS
SUMMARY	:	NAWC PT MUGU/311000E	MONITOR		COMPLETE 07SEP01

REFERENCES	:	IDENTIFICATION	REFERENCE BRIEF
	:	VF-41 MESSAGE 061315ZSEP01	PROBLEM REPORT
	:	NAWC PT MUGU/311000E MESSAGE	REPLY/CLOSING
	:	070729ZSEP01	

30-NOV-01

**BOMBS ACTIVE (HANDLING DAMAGE)
AIRBORNE WEAPONS CORRECTIVE ACTION PROGRAM**

PROBLEM NO: 15620

CLOSED

	NOMENCLATURE	PART/DOC. NO.	FSC	NIIN	NALC
END ITEM :	DISPENSER AND BOMB	1248AS100	1325	01-081-3378	E809
	DISPENSER AND BOMB	1291AS204	1325	01-283-5831	E895
	DISPENSER AND BOMB	1569339	1325	00-255-6307	E173
	INITIATOR	2601820	1325	00-234-0071	GW04
	DISPENSER AND BOMB	2605197	1325	00-255-6307	E173
	DISPENSER AND BOMB	2605197	1325	01-006-0059	E835
	DISPENSER AND BOMB	653AS100	1325	00-512-2791	E838
	DISPENSER AND BOMB, AIRCRAFT	930AS100	1325	01-283-5830	E895

EI CNTRL NO:

PROB BRIEF : MK-20 CBU SHIPPING CONTAINER PUNCTURED

PROBLEM : CNU-238 tipped to one side when sling was not unhooked from one side.
DESCRIPTION

PREVENTIVE : Crane operator pay close attention to dockside personnel.
ACTION

CORRECTIVE : No further action required.
ACTION

	SOURCE	TYPE	DOCUMENT NO.	DATE	DR STATUS
OCCURRENCES:	NWS CHARLESTON	CODR	N69214-01-0002	28MAR01	CLOSED
	NAS LEMOORE	CODR	N63042-99-0002	23DEC99	CLOSED *
	NAS FALLON	CODR	N60495-99-0001	04MAY99	CLOSED *
	VMA-214	EMR	M09436-98-0004	13FEB98	CLOSED *
	FLEACT SASEBO	CODR	N62735-95-0001	19SEP95	CLOSED *
	NWS CHARLESTON	CODR	N69214-95-0017	05SEP95	CLOSED *
	NAWC CHINA LAKE	CODR	N60530-95-0002	18JUL95	CLOSED *
	NAWS CHINA LAKE	EMR	N68937-94-0016A	25JUL94	CLOSED *
	NWS EARLE	CODR	N60478-94-0002	18FEB94	CLOSED *

*** ACTION REPORTED IN PREVIOUS PUBLICATION**

ACTION : NWS CHARLESTON CODR N69214-01-0002 28MAR01 CLOSED

	PART/DOC. NO.	FSC	NIIN	NALC
END ITEM :	930AS100	1325	01-283-5830	E895
	NOMEN: DISPENSER AND BOMB, AIRCRAFT			
	LOT: CRA75B001M019C			
FAILED PART:	930AS1000	1325	01-283-5830	E895
	NOMEN: DISPENSER AND BOMB, AIRCRAFT			
	LOT: CRA75B001M019C			

30-NOV-01

**BOMBS ACTIVE (HANDLING DAMAGE)
AIRBORNE WEAPONS CORRECTIVE ACTION PROGRAM**

PROBLEM NO: 15620

(Continued)

DESCRIPTION:

It was reported that during loading of MK-20 Mod 12 CBU, NALC E895, Lot CRA75B001M019C weapons in MK-427 shipping and storage containers for shipment to NSWC Crane. Container locking pin impacted roof of commercial trailer puncturing a hold two inches in diameter in the roof of the commercial trailer.

ACTION TAKEN:

NAWC Pt. Mugu 090229ZAPR01: Request notify receiving department of this incident so verification of acceptability of container/weapon can be ensured. No further action planned. Problem will be monitored for future occurrences. This is closing action.

ACTION	:	ACTIVITY/CODE	ASSIGNMENT	DUE DATE	STATUS
SUMMARY		NAWC PT MUGU/311000E	MONITOR		COMPLETE 09APR01
REFERENCES	:	IDENTIFICATION		REFERENCE BRIEF	
		NWS CHARLESTON MESSAGE 281228ZMAR01		PROBLEM REPORT	
		NAWC PT MUGU/311000E MESSAGE		REPLY/CLOSING	
		090229ZAPR01			

30-NOV-01

**BOMBS ACTIVE (HANDLING DAMAGE)
AIRBORNE WEAPONS CORRECTIVE ACTION PROGRAM**

PROBLEM NO: 16988

CLOSED

	NOMENCLATURE	PART/DOC. NO.	FSC	NIIN	NALC
END ITEM :	FIN ASSEMBLY	923AS159	1325	01-163-3434	F766

EI CNTRL NO:

PROB BRIEF : BSU-86/B FIN DAMAGED DURING HANDLING

PROBLEM : BSU-86/B fins damage by forklift operator.
DESCRIPTION

PREVENTIVE : Attention to detail during ordnance operations.
ACTION

CORRECTIVE : Attention during ordnance operations.
ACTION

	SOURCE	TYPE	DOCUMENT NO.	DATE	DR STATUS
OCCURRENCES:	MCAS IWAKUNI	CODR	M62613-01-0001	28AUG01	CLOSED
ACTION :	MCAS IWAKUNI	CODR	M62613-01-0001	28AUG01	CLOSED

	PART/DOC. NO.	FSC	NIIN	NALC
END ITEM :	923AS159	1325	01-163-3434	F766
	NOMEN: FIN ASSEMBLY			
	LOT: TTP88-F-001-068B			
FAILED PART:	923AS159	1325	01-163-3434	F766
	NOMEN: FIN ASSEMBLY			
	LOT: TTP88-F-001-068B			

DESCRIPTION:

It was reported that during normal operations one BSU-86/B fin, NALC F766, Lot TTP88-F-001-068B was damaged by the maintenance handling equipment while backing without proper clearance. The rear of forklift impacted one fin on the full pallet.

ACTION TAKEN:

NAWC Pt. Mugu 280329ZAUG01: Place fin in Condition Code "F" and annotate tag "Retention band broken, bent". Also annotate tag with Defect Code ZFNZ60. Request disposition from Item Manager, Naval Ammunition Logistics Center, Mechanicsburg, PA. Problem will be monitored for future occurrences. This is closing action.

ACTION	:	ACTIVITY/CODE	ASSIGNMENT	DUE DATE	STATUS
SUMMARY		NAWC PT MUGU/311000E	MONITOR		COMPLETE 28AUG01

30-NOV-01

BOMBS ACTIVE (HANDLING DAMAGE)
AIRBORNE WEAPONS CORRECTIVE ACTION PROGRAM

PROBLEM NO: 16988

(Continued)

REFERENCES : IDENTIFICATION

MCAS IWAKUNI MESSAGE 280203ZAUG01
NAWC PT MUGU/311000E MESSAGE
280329ZAUG01

REFERENCE BRIEF

PROBLEM REPORT
REPLY/CLOSING